

All cargo doors were found intact and attached to the fuselage structure except for the forward cargo door which had some fuselage and cargo floor attached. This door, located on the forward right side of the aircraft, was broken horizontally about one-quarter of the distance above the lower frame. The damage to the door and the fuselage skin near the door appeared to have been caused by an outward force. The fractured surface of the cargo door appeared to have been badly frayed. Because the damage appeared to be different than that seen on other wreckage pieces, an attempt to recover the door was made by CCGS John Cabot. Shortly after the wreckage broke clear of the water, the area of the door to which the lift cable was attached broke free from the cargo door, and the wreckage settled back onto the sea bed. An attempt to relocate the door was unsuccessful.

